





MRA 0

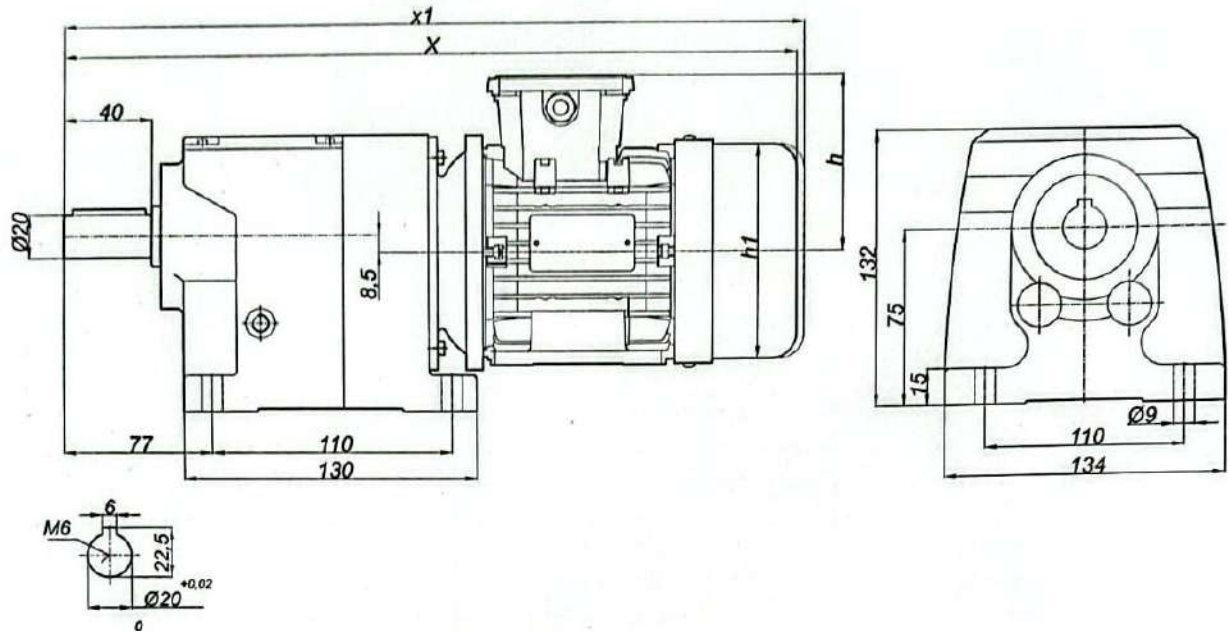


MRF 0

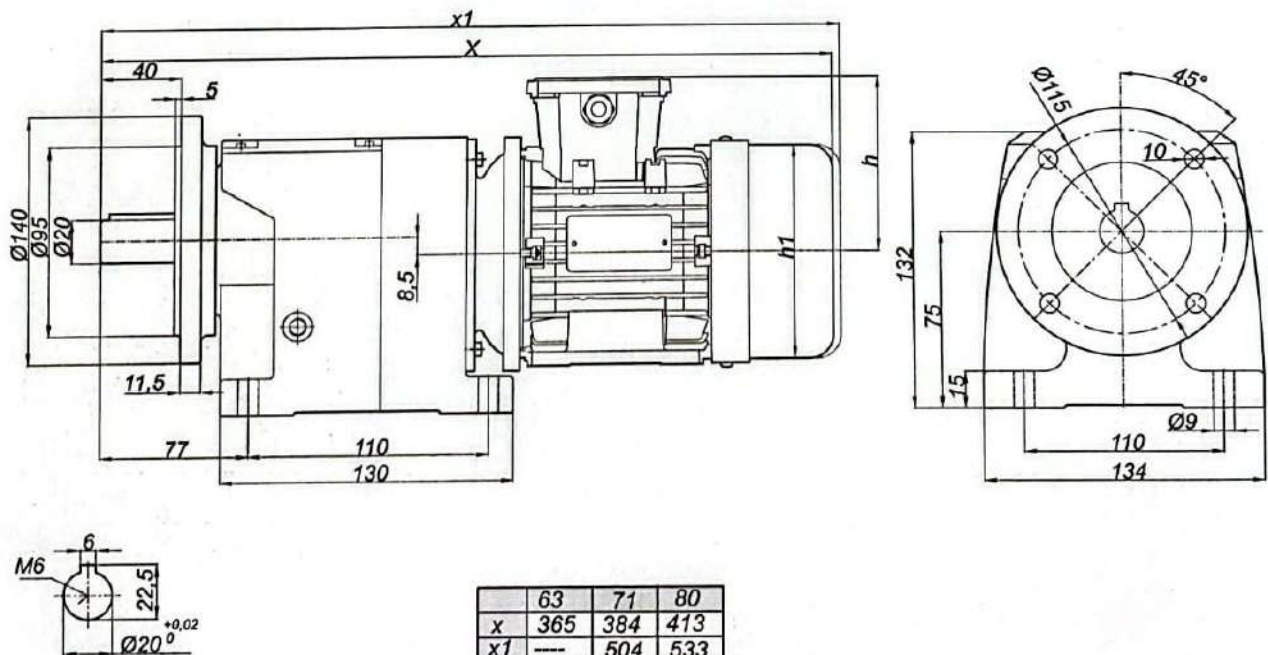



	63	71	80
x	365	384	413
$x1$	---	504	533
h	98	110	118
$h1$	125	136	154



MNA 0

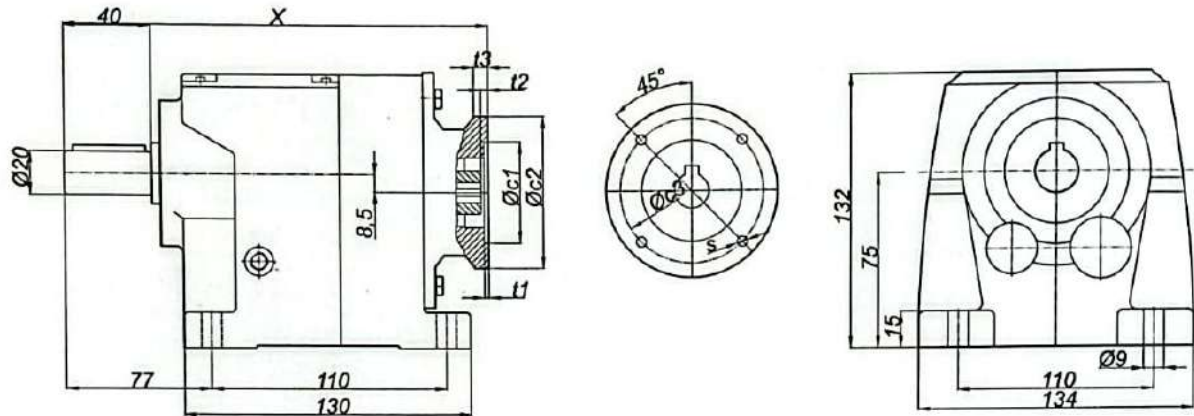


MNF 0

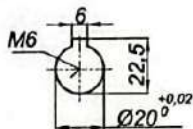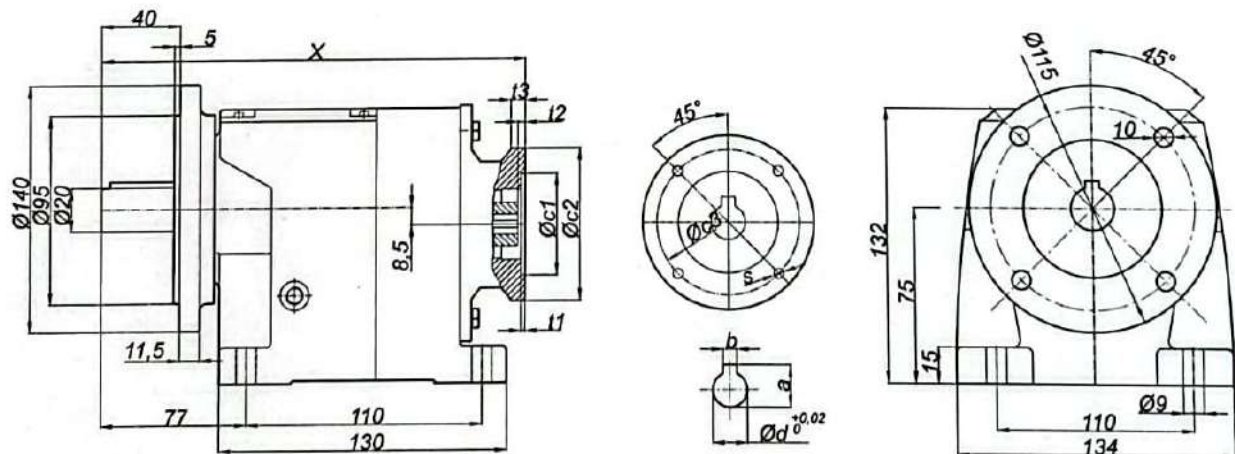



	x	$\varnothing c1$	$\varnothing c2$	$\varnothing c3$	$t1$	$t2$	$t3$	$\varnothing s$	$\varnothing d$	a	b
63/B14	216	60	90	75	3	5	10	5,5	11	12,8	4
71/B14	216	70	105	85	3	5	10	7	14	16	5
80/B14	231	80	120	100	4	6	12	7	19	21,5	6
90/B14	231	95	140	115	4	6	12	9	24	27	8



MRA 1

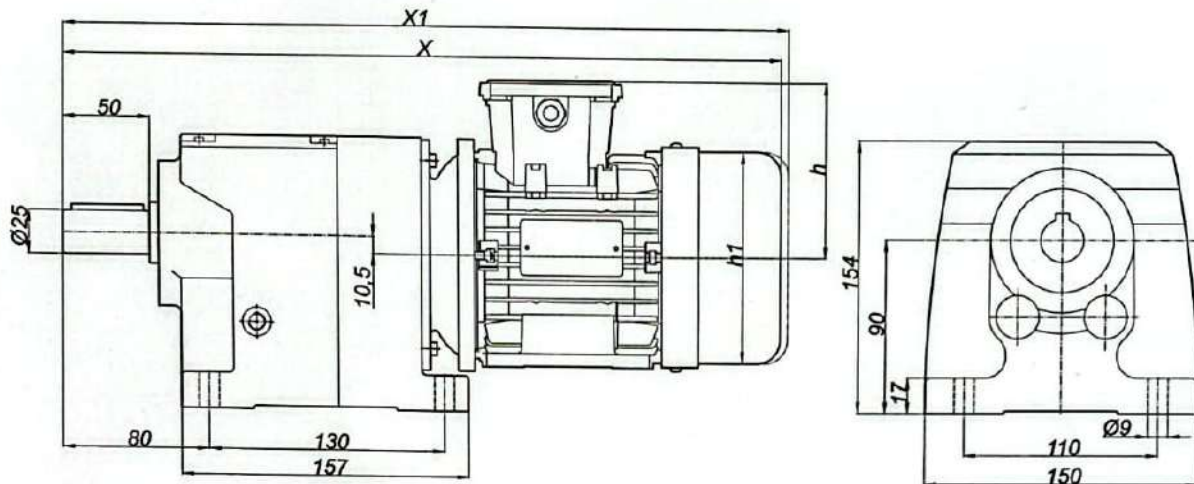


MRF 1

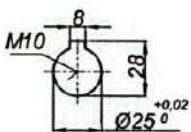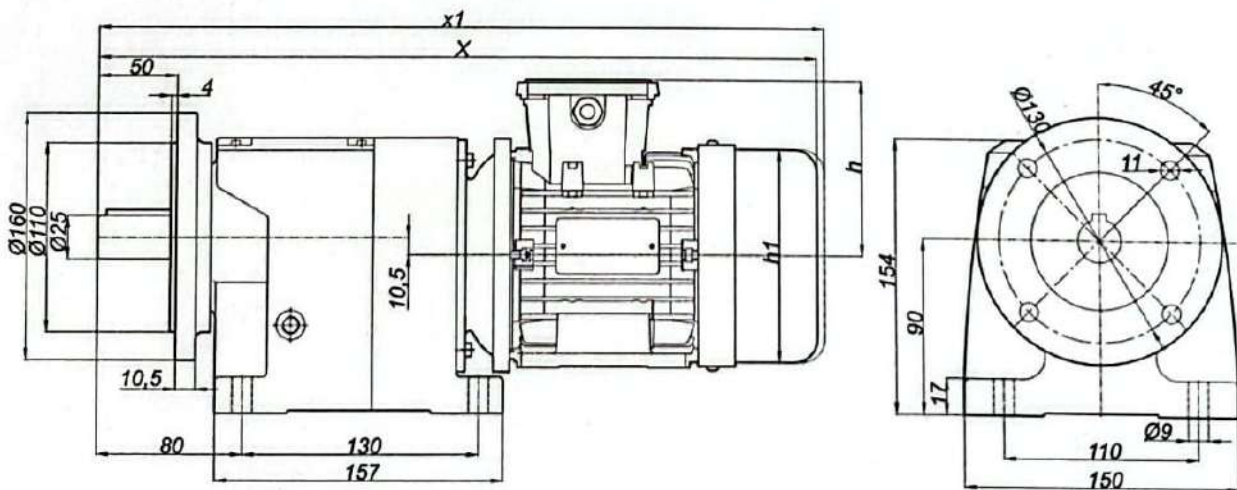


	63	71	80	90S	90L
x	393	412	442	464	494
x1	—	532	562	589	619
h	98	110	118	126	126
h1	125	136	154	172	172



MNA 1

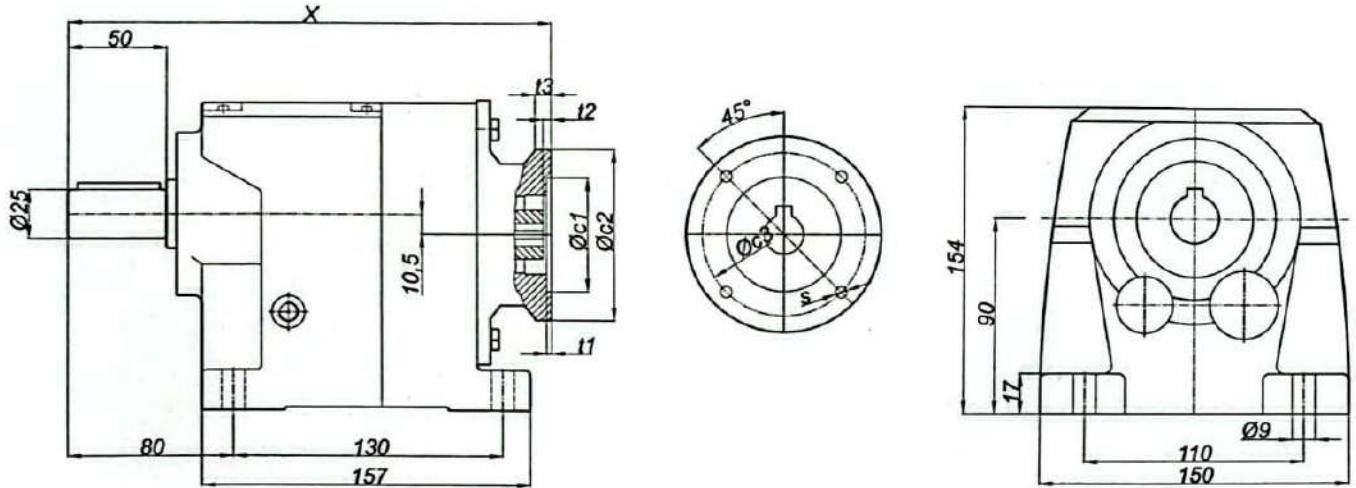


MNF 1

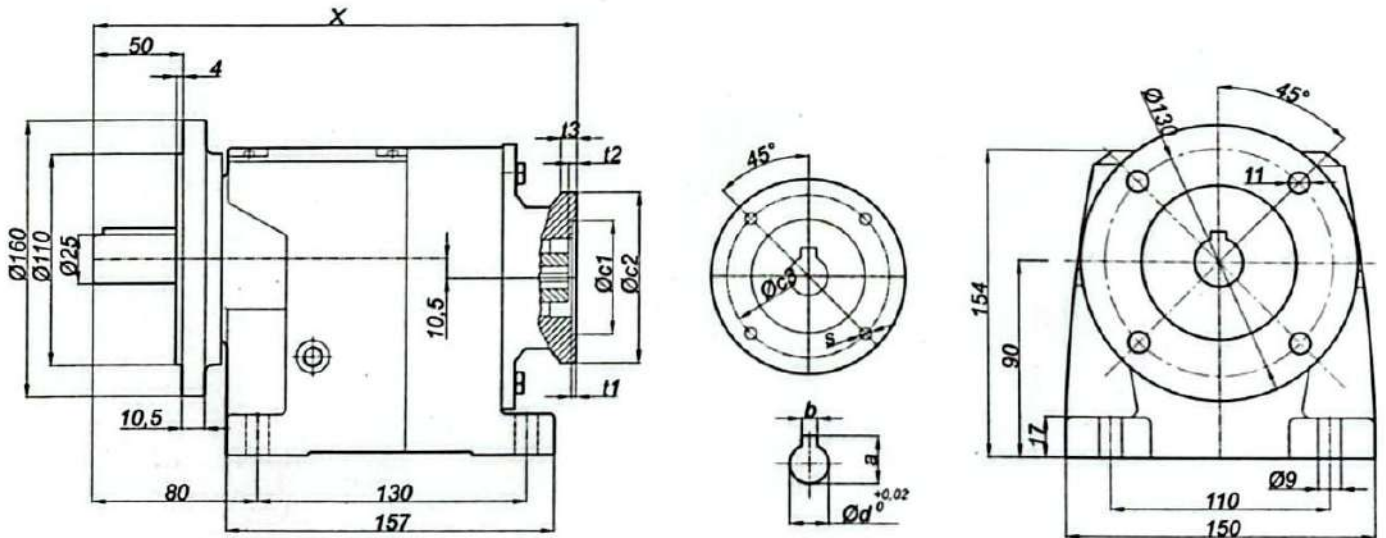



	x	Øc1	Øc2	Øc3	t1	t2	t3	Øs	Ød	a	b
63/B14	246	60	90	75	3	5	10	5.5	11	12.8	4
71/B14	246	70	105	85	3	5	10	7	14	16	5
80/B14	261	80	120	100	4	6	12	7	19	21.5	6
90/B14	261	95	140	115	4	6	12	9	24	27	8



MRA 2

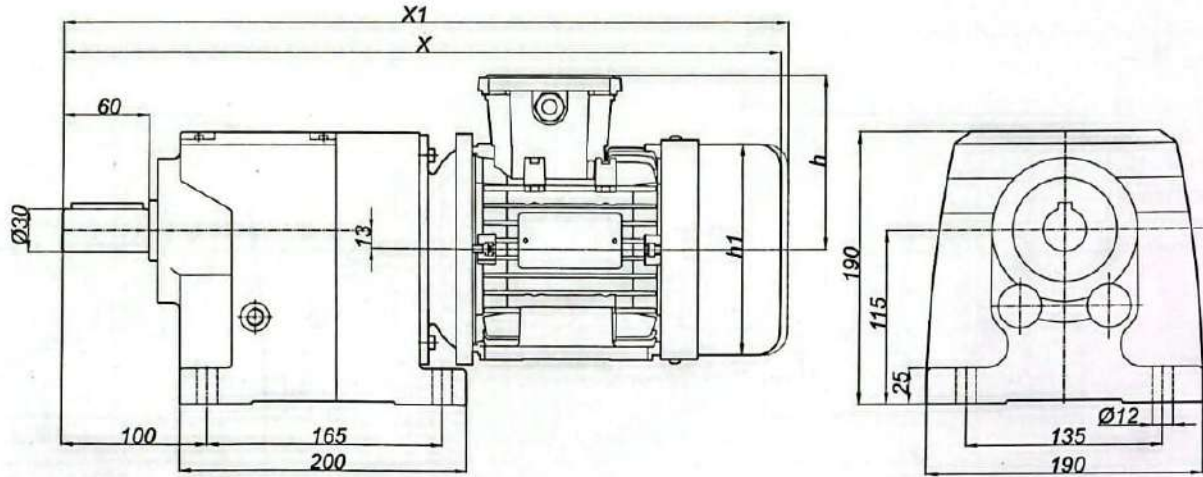


MRF 2

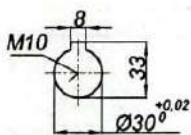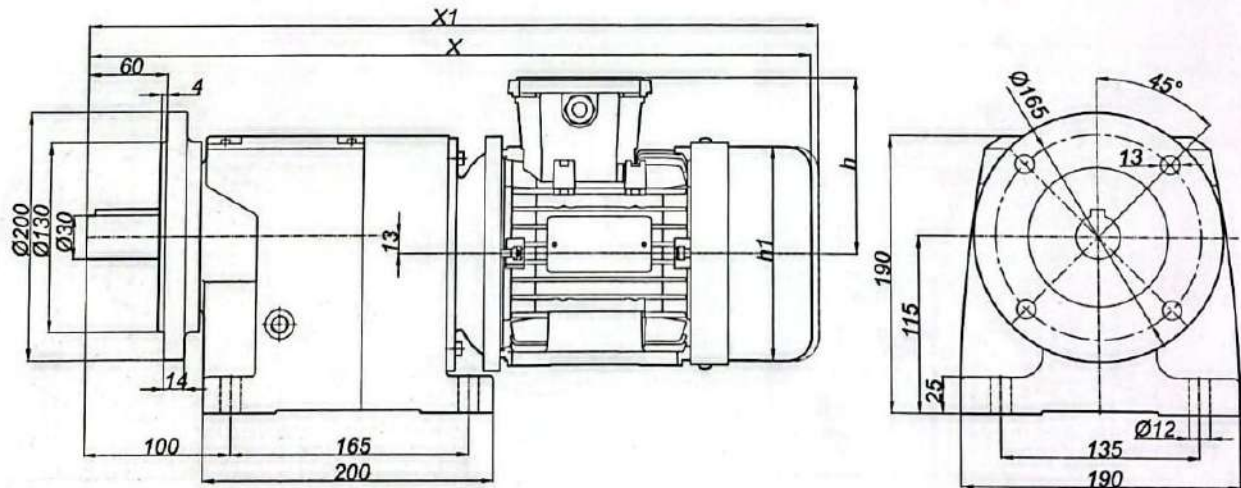



	63	71	80	90S	90L	100L	112
x	438	460	491	517	542	580	602
x1	---	580	611	642	667	715	737
h	98	110	118	126	126	135	146
h1	125	136	154	172	172	191	140



MNA 2

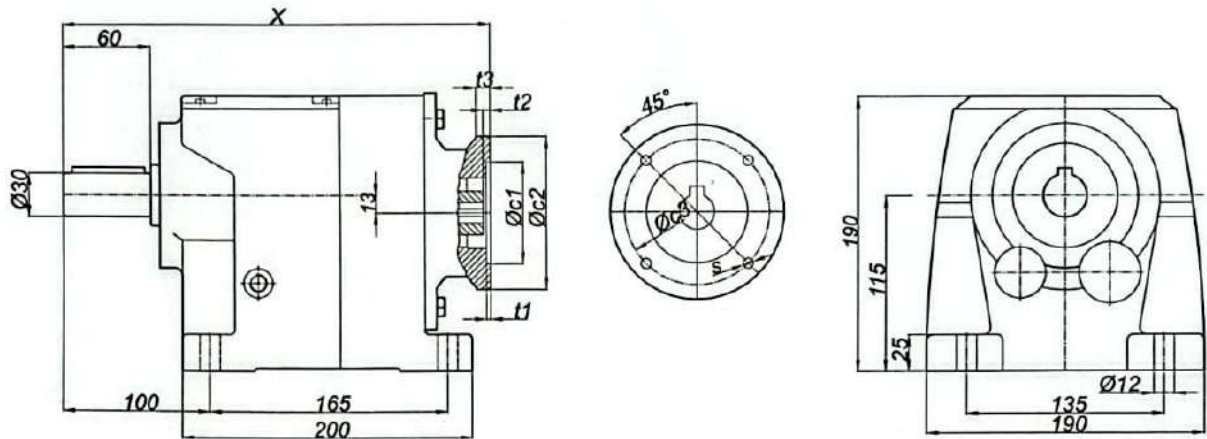


MNF 2

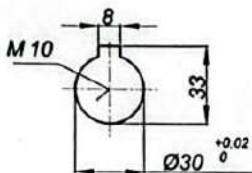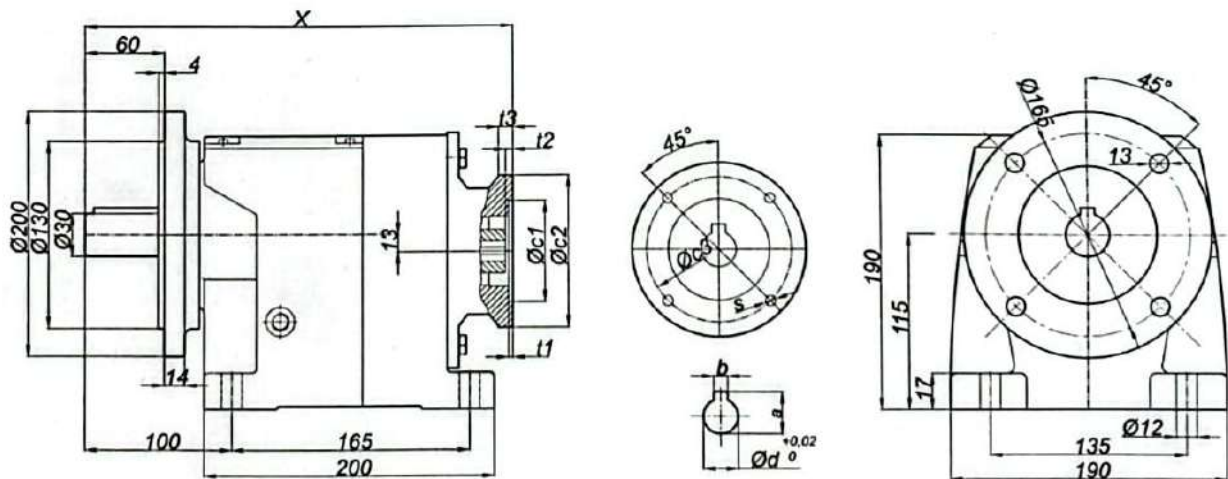



	x	$\varnothing c1$	$\varnothing c2$	$\varnothing c3$	t1	t2	t3	$\varnothing s$	$\varnothing d$	a	b
71/B14	294,5	70	105	85	3	5	10	7	14	16	5
80/B14	309,5	80	120	100	4	6	12	7	19	21,5	6
90/B14	309,5	95	140	115	4	6	12	9	24	27	8
100-112/B14	315,5	110	160	130	4	6	12	9	28	31	8



MRA 3

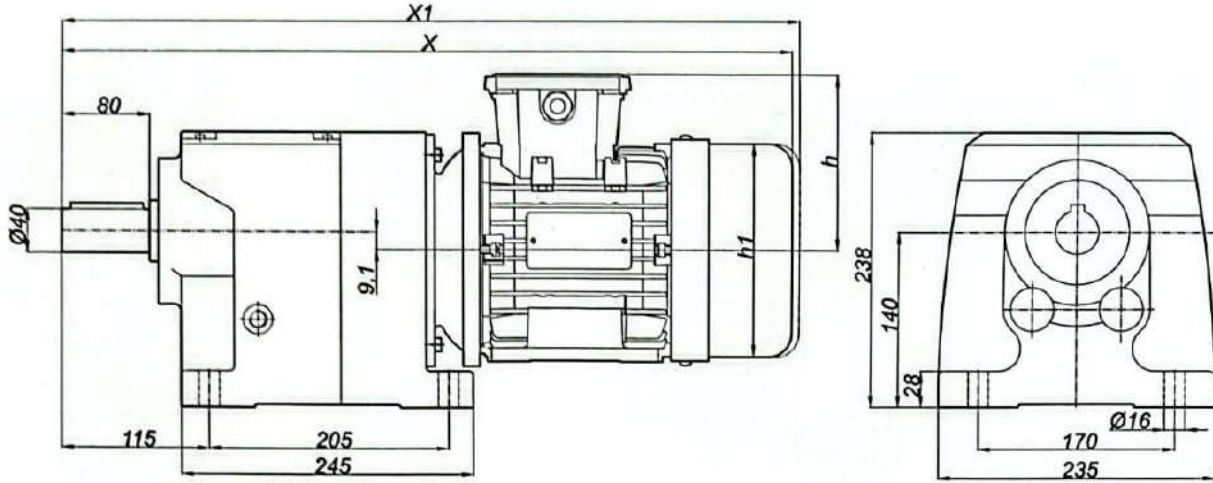



MRF 3

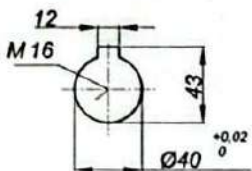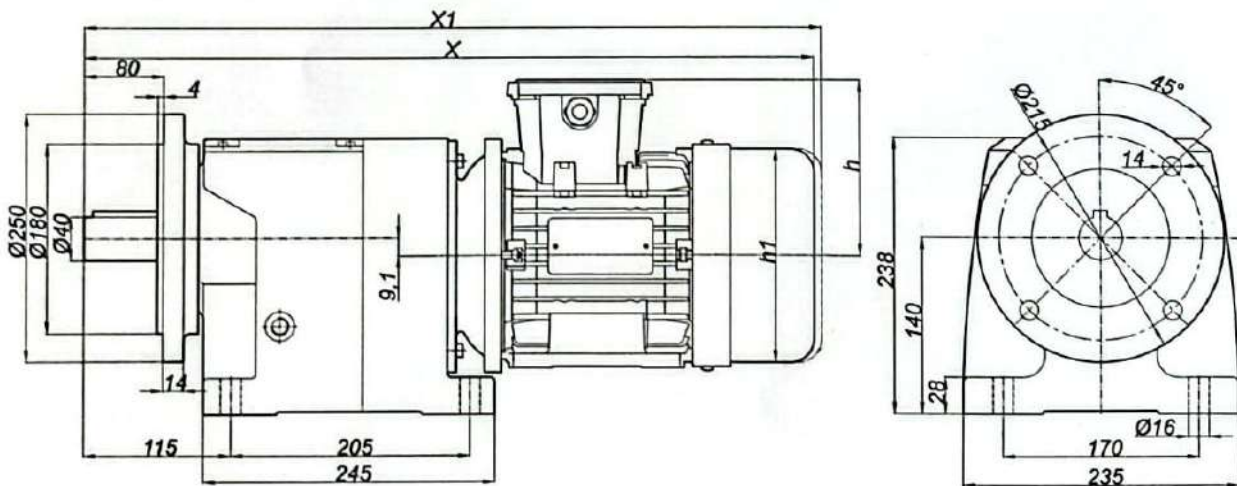





	80	90S	90L	100L	112	132S	132M
x	551	574	599	638	660	706	749
x1	671	699	724	773	795	851	894
h	118	128	128	140	164	185	185
h1	154	172	172	191	215	255	255



MNA 3

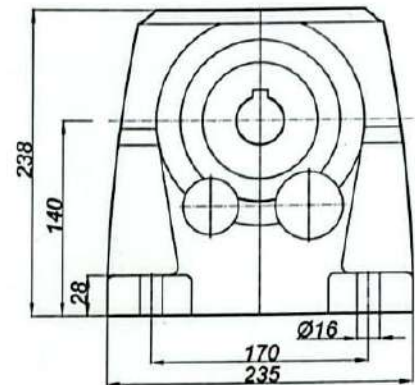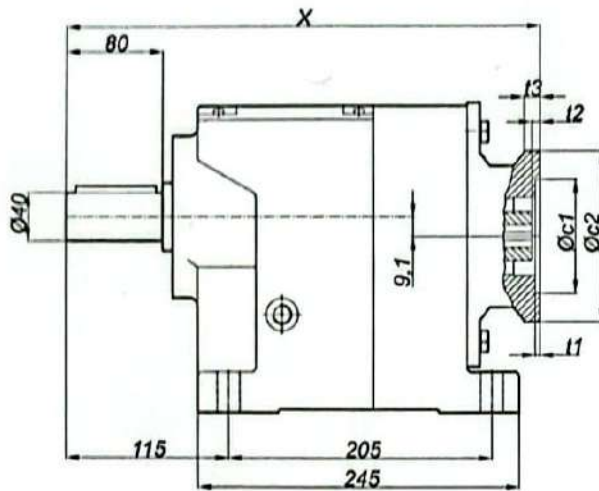

MNF 3

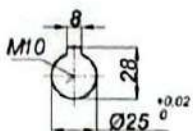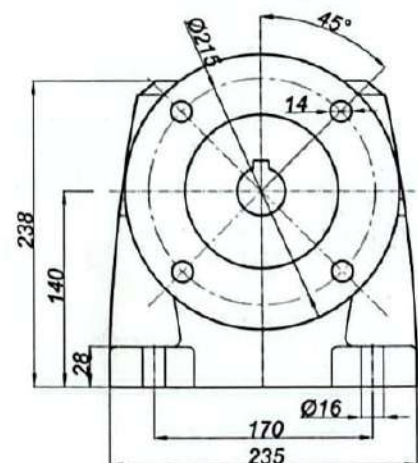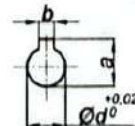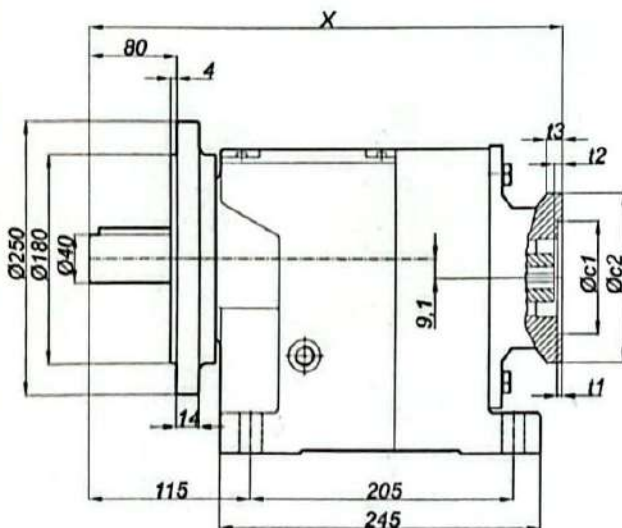

	x	$\phi c1$	$\phi c2$	$\phi c3$	$t1$	$t2$	$t3$	ϕs	ϕd	a	b
80/B14	357	80	120	110	4	6	12	7	19	21,5	6
90/B14	357	95	140	115	4	6	12	9	24	27	8
100-112/B14	363	110	160	130	4	6	12	9	28	31	8